

LAND CORNER RECORD

Index: U-13	Corner: S1/16 Corner between Sections 27 and 28			State of Indiana - Hoosier National Forest
Section: 28	Township: 7N	Range: 1E	P.M.: 2nd	County: Monroe
Coordinate:	Lat./N: 1370430.73	Long./E: 3145240.42	Datum: NAD83 IN West Zone, US Survey Feet	


CORNER HISTORY: (Chronological history of corner)

1.) Date of Survey:	Surveyor:	Monument:	Recording Information:	Monument Photograph:
1880	George Vannoy Monroe County Surveyor	Stone set	Monroe County Surveyor's Office Bk. 2, Pg. 324	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
	B. Oak	22"	S04°W	34 lks
	B. Oak	10"	N16°W	27-1/2 lks
Record evidence of prior survey:				
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:	
6/23/1981	Lee Utt L.S. #80040089	A 2-1/2" iron pipe with a stamped 3" brass cap set	USDA Forest Service Bedford, IN	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
	Maple	5"	N59°W	29.10'
	W. Oak	17"	S30°E	10.90'
	Dogwood	4"	N11°W	24.60'
Record evidence of prior survey:	A possible stump hole was found S04°W - 22.00'. (see 1880 ref. objects)			

ACCESSORIES: Bearing and distance from monument to witness object.

Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
* = old blaze at base of tree	Sugar Maple*	18"	N55°W	29.10'
	White Oak*	29"	S32°E	10.90'
	Pine	12"	N73°E	30.05'
Monument Found or Set:	A 2-1/2" iron pipe with a 3" brass cap stamped "T7N R1E S1/16 S.28 S.27 1981" was found flush.			


MONUMENT SKETCH

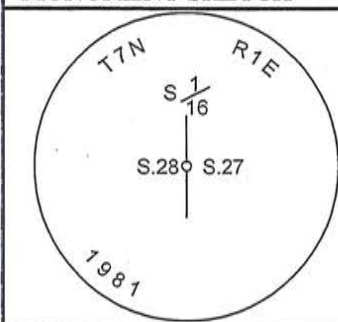

NARRATIVE REFERENCE:

Monument is a 2-1/2" iron pipe with a 3" brass cap stamped "T7N R1E S1/16 S.28 S.27 1981" found flush, a carsonite post is located 0.5' northwest of the monument, located on the east edge of a forest service trail that runs along the top of a northeast-southwest running ridge, +/- 500' northwest of an open field, a stand of pine trees are to the northwest and south, a steep east-west running ravine can be seen to the southeast, mature deciduous forest is to the southwest, a treated 4"X4" wood post is S05°E 6.0' of the monument.

SECTION DIAGRAM

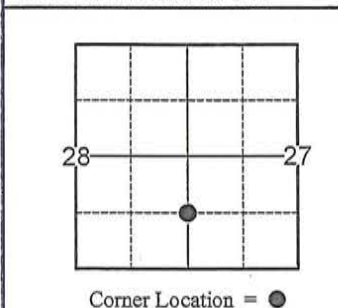

PERPETUATION RECORD:

The record monument was found undisturbed and maintained by remarking two existing bearing trees and establishing one new bearing tree. Two existing bearing trees were recovered from a Certified Land Corner Restoration by Lee Utt, dated 6/23/1981.

One new bearing tree was marked with a blaze, scribed B.T., bearing tree sign, paint, and mag nail and two existing bearing trees were marked with a bearing tree sign, paint and mag nail.

Referenced on BRCJ survey recorded as InstNo.2018007752

Accepted by the Monroe County Surveyor Review Board on August 6, 2019.

Section: 28 T7N R1E

Prepared By: BRCJ

(Project#3-0821)

Date: 3/2018